## Fineness of Grind Gages

Also called grind gages and Hegman gages. Many types of solid materials must be ground or milled into finer particles for dispersion in appropriate liquid vehicles. The physical properties of the resulting dispersions, often called "grinds", depend not only on the actual size of the individual particles, but also on the degree to which they are dispersed.

The Fineness of Grind Gage is used to indicate the fineness of grind or the presence of coarse particles or agglomerates in a dispersion. It does not determine particle size or particle size distribution.

Grind gages are used in controlling the production, storage, and application of dispersion products produced by milling in the paint, plastic, pigment, printing ink, paper, ceramic, pharmaceutical, food, and many other industries.

The Fineness of Grind Gage is a flat steel block in the surface of which are two flat-bottomed grooves varying uniformly in depth from a maximum at one end of the block to zero near the other end. Groove depth is graduated on the block according to one or more scales used for measuring particle size.

Most gages will have one scale marked in either mils or microns. 1 mil = 25.4 microns

1 mil = 0.001 inch


1 micron, µm = 0.001 mm or 10-6 m

The Hegman scale or National Standard scale may be abbreviated "NS" on the gage. The scale ranges from 0 to 8 with numbers increasing as the particle size decreases.

- 0 Hegman = 4 mil/100 micron particle size
- 4 Hegman = 2 mil/50 micron particle size
- 8 Hegman = 0 mil/0 micron particle size

BYK-Gardner offers a wide variety of grind gages varying in scales, number of grooves, length and width of grooves and size of the block.

Comes in a reusable storage box to prevent damage.

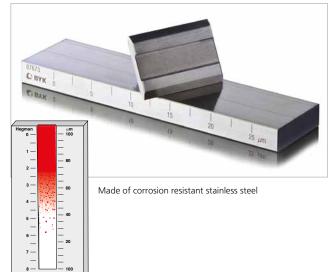

| Standards |                       |  |  |  |
|-----------|-----------------------|--|--|--|
| ASTM      | D 333, D 1210, D 1316 |  |  |  |
| ISO       | 1524                  |  |  |  |
| FTMS      | 141a, Method 4411.1   |  |  |  |

## Procedure

Place a slight excess of sample in the deep end of the groove, and with the straight-edge scraper provided, draw the sample toward the shallow end of the groove. Ratings are in terms of the point on the scale where the oversize particles, or furrows made by them, first appear in substantial concentration.

| Ordering | Information             | Accessories        |                 |
|----------|-------------------------|--------------------|-----------------|
| Cat. No. | Description             | Net Weight         | Shipping Weight |
| PD-1518  | Replacement Scraper, SS | 0.12 kg (0.26 lbs) | 0.45 kg (1 lbs) |



**Certified** For Certification Service see page 269.



## Fineness of Grind Gages

| Orderin                           | Information                  | Technical S | Technical Specifications |                   |                   |                     |                    |
|-----------------------------------|------------------------------|-------------|--------------------------|-------------------|-------------------|---------------------|--------------------|
| Cat. No.                          | Description                  | Path Size   | No. of<br>Paths          | Scales            | Range             | Dimensions          | Net Weight         |
| PD-1509                           | Grindometer 15*              | 13 x 130 mm | 2                        | Micron/           | 0 - 15<br>8 - 6.8 | 169 x 42 x 13 mm    | 1 kg               |
| PD-1510 Grindometer 25*           | Grindomator 25*              | 13 x 130 mm | 2                        | Hegman<br>Micron/ | 0 - 25            | 169 x 42 x 13 mm    | (2.2 lbs)<br>1 kg  |
|                                   | Gindometer 25                | 15 x 150 mm | Z                        | Hegman            | 8-6               | 109 x 42 x 13 11111 | (2.2 lbs)          |
| PD-1511 Grindometer 50*           | Grindometer 50*              | 13 x 130 mm | 2                        | Micron/           | 0 - 50            | 169 x 42 x13 mm     | 1 kg               |
|                                   |                              |             | -                        | Hegman            | 8 - 4             |                     | (2.2 lbs)          |
| PD-1512 Grindometer 100*          | Grindometer 100*             | 13 x 130 mm | 2                        | Micron/           | 0 - 100           | 169 x 42 x 13 mm    | 1 kg               |
|                                   |                              |             |                          | Hegman            | 8 - 0             |                     | (2.2 lbs           |
| PD-2500                           | Gage No. 25                  | 0.5 x 2 in  | 2                        | Hegman/           | 8 - 0             | 0.5 x 2.5 x 4.75 in | 0.9 kg             |
|                                   |                              |             |                          | Mils              | 0 - 5             |                     | (2.0 lbs)          |
| PD-2501                           | Gage No. 45                  | 0.5 x 4 in  | 2                        | Hegman/           | 8 - 0             | 0.5 x 2.5 x 6.75 in | 1.6 kg             |
|                                   |                              |             |                          | Mils              | 0 - 5             |                     | (3.5 lbs)          |
| PD-2502                           | Gage No. 65                  | 0.5 x 6 in  | 2                        | Hegman/           | 8 - 0             | 0.75 x 2.5 x 8 in   | 1.8 kg             |
|                                   |                              |             |                          | Mils              | 0 - 5             |                     | (4.0 lbs)          |
| PD-2503                           | Gage No. 5251                | 0.5 x 5 in  | 2                        | Microns/          | 0 - 25            | 0.5 x 2.5 x 6.75 in | 1.8 kg             |
|                                   |                              |             |                          | Mils/             | 0 - 1             |                     | (4.0 lbs)          |
|                                   |                              |             |                          | Hegman            | 8 - 6             |                     |                    |
| PD-2504                           | Gage No. 5252                | 0.5 x 5 in  | 2                        | Microns/          | 0 - 50            | 0.5 x 2.5 x 6.75 in | 1.8 kg             |
|                                   |                              |             |                          | Mils/             | 0 - 2             |                     | (4.0 lbs           |
|                                   |                              |             |                          | Hegman            | 8-4               |                     | 1.0 1.             |
| PD-2505                           | <b>'D-2505</b> Gage No. 5254 | 0.5 x 5 in  | 2                        | Microns/<br>Mils/ | 0 - 100<br>0 - 4  | 0.5 x 2.5 x 6.75 in | 1.8 kg<br>(4.0 lbs |
|                                   |                              |             |                          | Hegman            | 0 - 4<br>8 - 0    |                     | (4.0 105           |
| PD-2506                           | –                            | 2 x 5 in    | 1                        | Hegman/           | 8 - 0             | 0.75 x 3.5 x 7.5 in | 3.6 ko             |
| 10-2500                           | dage No. 54                  | 2 \  5 \    | 1                        | Microns           | 0 - 100           | 0.75 × 5.5 × 7.5 m  | (8.0 lbs           |
| PD-2507                           | <br>Gage No. 52              | 2 x 5 in    | 1                        | Hegman/           | 8 - 4             | 0.75 x 3.5 x 7.5 in | 3.6 kg             |
|                                   |                              | 2 / 3       |                          | Microns           | 0 - 50            |                     | (8.0 lbs)          |
| PD-2508                           | Gage No. 51                  | 2 x 5 in    | 1                        | Hegman/           | 8 - 6             | 0.75 x 3.5 x 7.5 in | 3.6 kg (8.0        |
|                                   | 5                            |             |                          | Microns           | 0 - 25            |                     | lbs                |
| PD-2509                           | –<br>Gage No. 6251 - G1      | 1 x 6.25 in | 2                        | Hegman/           | 8 - 6             | 1 x 3.5 x 9.5 in    | 5.0 kg             |
|                                   | -                            |             |                          | Micron/           | 0 - 25            |                     | (11 lbs)           |
|                                   |                              |             |                          | NPIRI             | 0 - 10            |                     |                    |
| PD-2510                           | Gage No. 6252 - G2           | 1 x 6.25 in | 2                        | Hegman/           | 8 - 4             | 1 x 3.5 x 9.5 in    | 5.0 kg             |
|                                   |                              |             |                          | Microns/          | 0 - 50            |                     | (11 lbs)           |
|                                   |                              |             |                          | NPIRI             | 0 - 20            |                     |                    |
| <b>PD-2511</b> Gage No. 6254 - G3 | Gage No. 6254 - G3           | 1 x 6.25 in | 2                        | Hegman/           | 8 - 0             | 1 x 3.5 x 9.5 in    | 5.0 kg             |
|                                   |                              |             |                          | Microns/          | 0 - 100           |                     | (11 lbs)           |
|                                   |                              |             |                          | NPIRI             | 0 - 30            |                     |                    |
| PD-2512                           | Gage No. PD-250              | 1 x 6.25 in | 2                        | Microns/          | 0 - 50            | 1 x 3.5 x 9.5 in    | 5.0 kg             |
|                                   |                              |             |                          | Microns           | 0 - 250           |                     | (11 lbs)           |
| PD-2513                           | Gage No. PB-20               | 0.5 x 8 in  | 2                        | Mils              | 0 - 20            | 1 x 2.5 x 9.5 in    | 3.0 kg             |
|                                   |                              |             |                          |                   |                   |                     | (6.5 lbs)          |
| PD-2515                           | Gage No. SI 1                | 0.5 x 6 in  | 2                        | Microns/          | 0 - 25            | 1 x 1.5 x 8 in      | 1.6 kg             |
|                                   |                              |             |                          | NPIRI             | 0 - 10            |                     | (3.5 lbs)          |

**Comes complete with:** Grind block Scraper Reusable Storage Case \*Designed to comply with ISO method 1524



170 Shields Court Unit 2 Markham, ON L3R 9T5 <u>TEL</u>: (905) 475-5880 ext. 226 <u>FAX</u>: (905) 475-1231